



Prestons Subdivision GEOTECHNICAL REPORT FOR LOT 4001 CDL Land NZ Limited

26 August 2021 Revision: 1

Reference: 235361



Document control record

Document prepared by: James Muirson

Aurecon New Zealand Limited

Level 2, Iwikau Building 93 Cambridge Terrace Christchurch 8013 New Zealand

T +64 3 366 0821

F +64 3 379 6955

E christchurch@aurecongroup.com

W aurecongroup.com

A person using Aurecon documents or data accepts the risk of:

- a) Using the documents or data in electronic form without requesting and checking them for accuracy against the original hard copy version.
- **b)** Using the documents or data for any purpose not agreed to in writing by Aurecon.

Document control aurecon										
Repo	ort title	GEOTECHNICAL REPORT FOR LOT 4001								
Document ID			Project nu	mber	235361					
File path		P:\235361\069 Stage 2 Building Consent\Geotech\Building Consent Reports\Development Lots\Lot 4001\235361 Building Consent Report Lot 4001.docx								
Client		CDL Land NZ Limited								
Client contact		Jason Adams	Client refe	rence						
Rev	Date	Revision details/status	Author	Author Reviewer		Approver				
0	20 October 2014	Draft for Review	J Muirson	J Muirson	J Kupec	T Browne				
1 26 August 2021		Final for Issue	C Scott	J Muirson		J Kupec				
Current revision		1								

Approval			
Author signature	Chur	Approver signature	Jan Chape-
Name	Chris Scott	Name	Dr Jan Kupec
Title	Geotechnical Engineer	Title	Technical Director



Contents

1	Executive Summary						
2	Introduction						
3	3 Site Conditions						
	3.1	Site Description	3				
	3.2	Surface Water	3				
	3.3	Regional Geology	3				
	3.4	Site Earthworks	3				
	3.5	Technical Classification	4				
4	4 Geotechnical Assessment						
	4.1	General	5				
	4.2	Previous Investigations	5				
	4.3	Hand Held Testing	5				
	4.4	Dynamic Cone Penetrometers	5				
	4.5	Groundwater Levels	6				
	4.6	Topsoil Depth	6				
5	Fou	ndation Recommendations	7				
	5.1	Foundation Types	7				
	5.2	Foundation Construction Recommendations	7				
6	References						
7	Explanatory Statement						

Appendices

Appendix A

Figures

Appendix B

Test Results

1 Executive Summary

CDL Land NZ Ltd has commissioned Aurecon New Zealand Ltd to undertake site specific geotechnical investigations and assessments for individual residential lots for building consent purposes for the Prestons South Subdivision Stage 2. This report documents the results of the geotechnical assessment and presents geotechnical comments together with foundation recommendations for the residential house on Lot 4001 at the Prestons South Subdivision.

As part of the subdivision development extensive geotechnical testing, including cone penetration tests (CPTs), were carried out to define the liquefaction potential at the overall subdivision and to monitor the site works that have occurred. Based on our information the property is likely to perform to a level equivalent to Technical Category 1 (TC1 - Grey) set by the Ministry of Business, Innovation and Employment (MBIE) in their guidelines issued in December 2012.

The site development has included extensive bulk earthworks. All earthworks and compliance testing have been undertaken in accordance with the earthworks specification. The engineering sign off and bulk earthworks are documented in the Geotechnical Completion Report. The earthfill at the subdivision construction stage was placed and signed off in accordance with NZS4431:1989. Based on review of the available geotechnical information, including bulk earthworks information and NZS4431 compliance records, we consider that a determination in accordance with NZS3604:2011 Section 3.1.3 is appropriate and the property meets the requirements for NZS3604 type foundations.

The geotechnical site specific assessment comprised a review of previous geotechnical investigations undertaken for the subdivision development and a site specific geotechnical investigation. Two hand auger boreholes were undertaken to assess the upper soil profile and groundwater level. Four dynamic cone penetrometers (DCPs) were carried out on the lot, two of the DCPs were located immediately adjacent to the hand auger boreholes with the other DCPs being located on the opposite side of the lot.

Based on our knowledge of the site setting and our past work we recommend that any residential structure that is to be developed on Lot 4001 be founded on standard NZS3604:2011 compliant foundations. These foundations require a minimum geotechnical ultimate bearing capacity of at least 300kPa, which for Lot 4001 is achieved at a minimum depth of 0.5m below ground level as this represents the current thickness of the topsoil and loose soil.

This report shall be read as a whole. Our limitations are presented in Section 7.



2 Introduction

CDL Land NZ Ltd is currently undertaking a large residential subdivision with associated commercial lots. Previously Aurecon New Zealand Ltd has undertaken detailed geotechnical investigations and assessments for the purpose of the plan change, subdivision resource consent application, liquefaction assessment, technical classification of the entire subdivision, and observation of bulk earthworks construction.

Aurecon New Zealand Ltd has since been commissioned to undertake site specific geotechnical investigations and assessment of individual lots for building consent application purposes. The site which this report is focused on comprises a single lot, designated Lot 4001 at the Prestons South Subdivision to the south of Prestons Road in Marshland, Christchurch. This report documents the results of the geotechnical assessment and presents geotechnical comments together with foundation recommendations for the proposed house on the lot. We note that at the time of writing this report the location and structural form of the dwelling were unknown, and it is inferred to comprise NZS3604:2011 type residential buildings only.

This report shall be read as a whole. Our limitations are presented in Section 7.



3 Site Conditions

3.1 Site Description

The Prestons Subdivision is located on the northern fringes of Christchurch City. The site is made up of a series of adjacent properties forming an irregular and elongated rectangle shape, orientated approximately north to south. The total area of the overall Prestons Subdivision site is approximately 190ha. The site can be separated into two distinct blocks, Prestons North which runs from the Lower Styx Road in the north through to Prestons Road in the south and the Prestons South development which continues from Prestons Road through to Mairehau Road to the south.

This building consent report is for Lot 4001 which is located in Stage 2 of the Prestons South Subdivision development (refer Figure 1 in Appendix A). The lot is bordered by a residential lot to the south, an access road to the east and an open storm water channel to the west and north.

3.2 Surface Water

There are no natural sources of surface water on the subdivision. There is a storm water channel to the west and north of Lot 4001.

3.3 Regional Geology

The geology of the site is described in the 1:250,000 scale geological map – 'Geology of the Christchurch Area', published in 2008 by the Institute of Geological and Nuclear Sciences. Note this map has been referenced as it is at an appropriate scale and covers the entire site. The map indicates the underlying geology comprises 'Dominantly sand of fixed and semi-fixed dunes and beach deposits' and 'drained peat swamp'. The subdivision geotechnical investigation identified that this area was predominantly underlain by aeolian (dune) and beach sand deposits.

The GNS Active Fault System database (GNS, 2012a) indicates that the site is located approximately:

- 27km north east of the eastern end of the Greendale Fault System. Movement on the Greendale Fault System was responsible for the Magnitude 7.1 Darfield (Canterbury) Earthquake on 4 September 2010.
- 14km north of the epicentre of the Magnitude 6.2 Christchurch Earthquake on 22 February 2011.
- 12km north west of the Magnitude 6.0 earthquake on 13 June 2011 (GNS, 2012b).
- 8km north west of the Magnitude 5.9 earthquake on 23 December 2012.

3.4 Site Earthworks

Site earthworks have been undertaken to prepare the site for residential building purposes. The subsurface profile was stripped and the site was built up with compacted engineered fill. During bulk earthworks shallow organic material, where encountered, was removed as part of the bulk earthworks.

All earthworks and compliance testing have been undertaken in accordance with the earthworks specification. Details of the site bulk earthworks are provided in the Aurecon report titled 'Prestons Park Subdivision – Stage U1 Geotechnical Completion Report' Rev 0, dated 9 October 2018. The Geotechnical Completion Report has been completed as part of the requirements of NZS4404:2010 'Land development and subdivision infrastructure' and Christchurch City Council 'Infrastructure Design Standards - Part 4: Geotechnical Requirements'. The compacted fill was placed and signed off in accordance with NZS4431:1989 'Code of practice for earth fill for residential development'.



3.5 Technical Classification

The landcheck maps historically provided on The Canterbury Earthquake Recovery Authority (CERA) website indicated the site is classified as rural and unmapped. The technical categories were developed by the Ministry for Business, Innovation and Employment (MBIE) with the support from the Engineering Advisory Group (EAG) in mid-2011 and hence prior to the start of the subdivision development. The site has since been modified by civil engineering and bulk earthworks.

As part of the subdivision consent geotechnical assessment, site specific liquefaction assessment was carried out over the wider subdivision area. This is detailed in the Aurecon reports titled 'Prestons Road Subdivision, Geotechnical Assessment Report for Resource Consent', Revision 2 dated 5 March 2012, 'Prestons Road Subdivision, Detailed Geotechnical Design Report', Revision 2 dated 12 July 2012 and 'Prestons South Subdivision Resource Consent Geotechnical Report', Revision 1 dated 6 June 2013.

Based on the results from our liquefaction assessment and bulk earthworks undertaken on the wider subdivision, Lot 4001 is likely to perform to a level equivalent to Technical Category 1 (TC1 - Grey) in the MBIE Guidelines issued in December 2012.



4 Geotechnical Assessment

4.1 General

The geotechnical assessment comprised a review of relevant previous geotechnical investigations and construction data and an in-situ geotechnical investigation. The geotechnical investigation comprised hand held testing on the individual lot and a review of the previous geotechnical investigations undertaken for the subdivision within the vicinity of the lot. Two hand auger boreholes were undertaken to assess the upper soil profile and groundwater level. Four dynamic cone penetrometers (DCPs) were carried out on the lot. The hand held testing was undertaken on the lot following the site earthworks. The testing density is considered reasonable as the geotechnical project engineers were involved in the observation of the civil engineering works.

4.2 Previous Investigations

The previous geotechnical testing and investigations undertaken by Aurecon across the entire subdivision site comprised of a combination of cone penetrometer tests (CPT) and machine excavated test pits. Further details regarding these investigation locations are found in the Aurecon reports titled 'Prestons Road Subdivision, Geotechnical Assessment Report for Resource Consent', Revision 2 dated 5 March 2012, 'Prestons Road Subdivision, Detailed Geotechnical Design Report', Revision 2 dated 12 July 2012 and 'Prestons South Subdivision Resource Consent Geotechnical Report', Revision 1 dated 6 June 2013. In addition, testing carried out as part of the subdivision development is presented in the Aurecon Geotechnical Completion Report.

4.3 Hand Held Testing

Two hand auger boreholes were undertaken on the lot as part of the geotechnical investigation to assess the upper soil profile and the groundwater level. The test location and the borehole log have been uploaded to the New Zealand Geotechnical Database (NZGD). The borehole log is attached in Appendix B. The hand held testing was undertaken at an earlier date, however it is still considered suitable for the purposes of building consent as no further earthworks or site modifications have been undertaken.

The hand auger borehole logs indicate the upper soil profile consists of topsoil underlain by sand to the termination depth. The hand auger boreholes were terminated when soil samples became saturated and the holes started to collapse.

The logging of the recovered hand auger samples was undertaken in accordance with the New Zealand Geotechnical Society's "Guideline for the Field Classification and Description of Soil and Rock for Engineering Purposes: 2005".

4.4 Dynamic Cone Penetrometers

Four DCPs were carried out with the locations and results uploaded to the NZGD. The DCP test results are attached in Appendix B. Two of the DCPs were located adjacent to the hand auger boreholes, with the other DCPs being located on the opposite half of the lot. The DCPs were undertaken at an earlier date, however they are still considered suitable for the purposes of building consent as no further earthworks or site modifications have been undertaken.

DCP logs indicate 5 blows per 100mm penetration, which is equivalent to an ultimate bearing capacity of 300kPa, was consistently encountered from a shallow depth.



4.5 Groundwater Levels

Groundwater levels were measured within the hand auger boreholes at the time of the investigation and correlated to our site specific knowledge. An indicative groundwater level was noted where holes collapsed due to saturated soil. Groundwater was encountered at approximately 1.9m depth below ground level. It should be noted that groundwater levels may vary seasonally.

A review of the NZGD indicates that regional groundwater levels are likely to be in the order of 1m to 2m below ground level. These groundwater levels are reasonably consistent with those measured during the investigation, when taking into account the subdivision earthworks filling and cutting.

4.6 Topsoil Depth

The depth of topsoil has been determined from the single hand auger and two DCPs undertaken on site. We note that the topsoil depths may vary by +/- 100mm between the testing locations and hence it is recommended that at least a 100mm tolerance should be allowed for building foundation excavations.

If greater certainty of topsoil depths across the whole site is required for construction costing then further testing would be necessary across the footprint of the proposed structure (unknown at the time of writing this report). The responsibility and liability for any additional testing shall be met by the section purchaser.



5 Foundation Recommendations

The site is expected to perform in line with TC1 requirements in future earthquakes. Due to the residential land use of the development, the presence of certified fill and the TC1 technical classification, future residential development will be able to adopt standard NZS3604 compliant foundations.

5.1 Foundation Types

It is recommended that residential structures that are built on Lot 4001 are founded on standard NZS3604:2011 compliant foundations. These foundations require a minimum geotechnical ultimate bearing capacity of at least 300kPa. The site investigation results indicate that approximately 300mm to 350mm of topsoil was present, which will need to be removed and the clean subgrade exposed for foundation construction.

Based on our understanding of the site works and the investigation results, we recommend that NZS3604:2011 compliant foundations are embedded a minimum depth of 0.5m below current ground level.

5.2 Foundation Construction Recommendations

Construction should proceed in accordance with the NZS3604:2011. Topsoil should be removed from beneath the floor slab and compacted hardfill placed under the floor slab to the required level. In addition, the following recommendations should be considered:

- 1. To ensure that excavated footings are adequately founded we recommend that excavations should be undertaken by a digger fitted with a smooth edge bucket. The base should be tidily trimmed by hand, lightly compacted with a plate compactor and immediately covered with a concrete tidy slab or 100mm of compacted granular hardfill. A suitable qualified engineer with foundation experience or territorial authority building inspector should be retained to verify the adequate founding has been achieved and all loose and soft or compressible material was removed.
- 2. If there are significant soft layers beneath a sub-excavation, the softer material will have to be excavated and backfilled with 10MPa concrete or compacted hardfill underneath all load bearing foundation elements. For the hardfill, the sub-excavation will have to have plan dimensions of B+2D where B is the footing width and D is the depth of undercut. For 10MPa concrete the sub-excavation can have the same dimensions as the footing.
- 3. Depending on the soil encountered, the time of year, and fluctuations of the groundwater level, it is possible that excavations may encounter groundwater. The building contractor is to take appropriate measures to deal with any groundwater ingress to the foundation excavations and keep the excavations and backfill free of groundwater intrusions until the footings are cast.
- 4. The footing excavations are likely to expose layers of granular soils, which can be adversely affected by rainfall or stormwater. Foundation excavations should not be left open for more than three days. In addition, rainfall and stormwater should not be allowed to pond within the footing excavations as this may affect the bearing capacity of the subsoils.



6 References

Forsyth, Barrell & Jongers, (compliers), 2008. *Geology of the Christchurch Area*. Institute of Geological and Nuclear Sciences, 1:250,000 Geological Map 16.

New Zealand Geotechnical Database (2016). Retrieved 1 May 2017 from https://www.nzgd.org.nz

Christchurch City Council, 2010. *Infrastructure Design Standards - Part 4: Geotechnical Requirements.*

Geonet, 2012. ftp://ftp.geonet.org.nz/strong/processed/Proc (23/10/12)

GNS, 2012a. http://maps.gns.cri.nz/website/af/viewer.htm (23/10/12)

GNS, 2012b. http://www.gns.cri.nz/Home/News-and-Events/Media-Releases/earthquake-part-of-aftershock-sequence (23/10/12)

Ministry of Business Innovation and Employment (MBIE), 2012 'Repairing and rebuilding houses affected by the Canterbury earthquakes'.

NZGS, 2005. *Guidelines for the Classification and Field Description of Soils and Rocks in Engineering.* NZ Geotechnical Society Inc, Wellington, New Zealand.

NZS 3604:2011. Timber Framed Buildings. Standards New Zealand, Wellington, New Zealand.

NZS 4404:2010 *Land development and subdivision infrastructure*. Standards New Zealand, Wellington, New Zealand.

NZS 4431:1989 Code of practice for earth fill for residential development. Standards New Zealand, Wellington, New Zealand.



7 Explanatory Statement

We have prepared this report in accordance with the brief as provided. The contents of the report are for the sole use of the Client for the purpose of building consent application only, and no responsibility or liability will be accepted to any other third party. Data or opinions contained within the report may not be used in other contexts or for any other purposes without our prior review and agreement.

The recommendations in this report are based on data collected at specific locations and by using suitable investigation techniques with limited site coverage. Only a finite amount of information has been collected to meet the specific financial and technical requirements of the Client's brief and this report does not purport to completely describe all the site characteristics and properties. The nature and continuity of the ground and groundwater between test locations has been inferred using experience and judgment and it must be appreciated that actual conditions could vary from the assumed model.

Subsurface conditions relevant to construction works should be assessed by contractors who can make their own interpretation of the factual data provided. They should perform any additional tests as necessary for their own purposes.

Subsurface conditions, such as groundwater levels, can change over time. This should be borne in mind, particularly if the report is used after a protracted delay.

This report is not to be reproduced either wholly or in part without our prior written permission.



Appendix A Figures



Appendix B Test Results



HAND AUGER RECORD

HOLE NO. Lot 4001 HA1

PROJECT NO. **235361**

PROJECT Prestons Park Subdivision Stage 2

CLIENT CDL Land NZ Ltd CO-ORDINATES (NZTM) SHEET 1 of 1

E 1573378

METHOD **HA**N 5185727

DATE from 18/09/2018 to 18/09/2018

MACHINE & NO. NA ORIENTATION VERTICAL GROUND-LEVEL +13.20 m RL

water level	Tests	Samples	Reduced	Depth (m)	Legend		RATA DESCRIPTION ON, MAJOR FRACTION, MINOR FRACTION, COLOUR, RE, STRENGTH, MOISTURE CONDITION ING, BEDDING, PLASTICITY, ETC SOCIETY- FIELD DESCRIPTION OF SOIL AND ROCK)
<u> </u>		Type Ref Depth	E 7	0.00			
		0.00		-	1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1	SILT with some sand; dark brown. Mo	oist; sand, fine. (TOPSOIL)
			+12.90	0.30	· · · · · · · · · · · · · · · · · · ·		
				_		Fine to coarse SAND; brownish grey.	. Moist.
				_			
				-			
				_			
				_			
		HA		_			
				-			
				_			
				_		1.60m Becomes wet.	
				-		noom Boodings wet.	
▼				-		1.90m Becomes saturated.	
				_			
			+10.90	2.30			
		-	+10.90			End of Hand	Auger at 2.30m, on 18/09/2018
				_		i erminatio	on Řeason: Hole collapsing.
				- -			
				_			
				_			
				_			
				_			
				_			
				-			
				_			
				_			
				_			
				L			
				Ë			
				L			
				_			
				_			
Sma	II Disturbed		Water L				MARKS
Small Disturbed Sample Large Disturbed Sample SPT Liner Sample Thin Wall Undisturbed Sample U100 Undisturbed Sample Large Disturbed Sample SPT Liner Sample Thin Wall Undisturbed Sample Large Disturbed Sample Spr Liner Sample Thin Wall Undisturbed Sample Permeability Test Piezometer / Standapipe Tip					oundwater encountered at 1.9m bgl.		
				DATE <u>18/09/2018</u> Co-	ordinates and elevation from site survey.		
	O Undisturbe	d Sample 🛔 🖞			ndpipe Tip	CHECKED J. MARTIN	vation based on Lyttelton Vertical Datum.
Pock	ket Penetrom	eter i est	Packer	1201		· · · · · · · · · · · · · · · · · · ·	



HAND AUGER RECORD

HOLE NO. Lot 4001 HA2

of

1

PROJECT NO. **235361**

PROJECT Prestons Park Subdivision
Stage 2

CLIENT CDL Land NZ Ltd CO-ORDINATES (NZTM) SHEET 1

METHOD HA DATE from 18/09/2018 to 18/09/2018

MACHINE & NO. NA ORIENTATION VERTICAL GROUND-LEVEL +13.26 m RL

MACI	HINE & NO	D. NA				ORIENTA	TION VERTICAL		GROUND-LEVEL	+13.26	m RL
								STRA	TA DESCRIPTION		
	T4-	0	Reduced Level	_	- T		SUBORDINATE			, COLOUR,	
Water level	Tests	Samples	evel	epth n)	Legend		ST (NZ GEOTEC)	RUCTURE, S GRADING,	MAJOR FRACTION, MINOR FRACTION STRENGTH, MOISTURE CONDITION BEDDING, PLASTICITY, ETC ETY - FIELD DESCRIPTION OF SOIL AN	ID BOCKI	
<u>è</u> ≷		Type Ref Depth 0.00	R	0.0 Depth 00 (m)	1						
-		0.00		_	76.70	SILT with sor	me sand; dark brow	vn. Mois	t; sand, fine. (TOPSOIL))	
-				-	1. 7.1.						
-			+12.91	0.35	76 70	Fine to seem	a CAND, browniah	arav M	a int		
						Fine to coarse SAND; brownish grey. Moist.					
-				-							
-				-							
-		HA		_							
-				-							
-				-							
-				-							
						1.60m Becor	nes wet.				
-				-							
- ▼				-		1 90m Becor	nes saturated.				
-		↓	+11.16	2.10		1.00111 20001					
_				_			End of I	Hand Au	ger at 2.10m, on 18/09/ <i>Reason:</i> Hole collapsing	2018	
-				-			1611	IIIIIaliOII	Neason. Hole collapsing	j.	
-				-							
-											
-				-							
-				-							
-				-							
-				-							
				Ė							
-				-							
-				-							
-				-							
_											
_				_							
-				-							
				-							
-				-							
[Ĺ							
[Į.							
				}							
• Sma	all Disturbed S	Sample ¥	Water I	_evel				REMA	ARKS		
Larg	ge Disturbed S	•		sion Pack	er Test	LOGGED	C. WILSON		dwater encountered at 1.9	am hal	
SPT	Γ Liner Sample				ation Test	DATE	18/00/2019				eV.
Thir		ırbed Sample		ability Tes		DATE 18/09/2018 Co-ordinates and elevation from site survey.					
	00 Undisturbed cket Penetrom	_			ndpipe Tip	CHECKE	J. MARTIN		Jacob C., Eymonoli Vo	Dutu	
Poc Pist	cket Penetrom ton Sample	eter lest	Packer In-situ	Test Vane She	ar Test	DATE	04/10/2018				
	. Tel: Fax:			50				1			



SCALA PENETROMETER NO.

Lot 4001 DCP1

PROJECT Prestons Park Subdivision

Stage 2

PROJECT NO. 235361

CO-ORDINATES (NZTM)

E 1573378

N 5185727

GROUND LEVEL +13.20 m RL

TESTED / SUPERVISED BY C. WILSON

DATE 18/09/2018

CHECKED BY J. MARTIN

DATE 04/10/2018

Results Depth (m) Blows per 100 mm Blows per 100 mm 0.0 3.5 3 4 3 5 7 4.0 0.5 7 8 10 11 13 1.0 4.5_ 17 20 5.0_ 2.0 2.5




Report ID: AGS4 DCP (SCALA) RECORD (5M) || Project: LOT 422 EDITED.GPJ || Library: AGS 4 0. GLB || Date: 5 March 2021

20 blows for 100mm in the last increment.

Co-ordinates and elevation data from site survey.

Elevation based on Lyttelton Vertical Datum.

Effective refusal, 20+ blows per 100mm penetration.

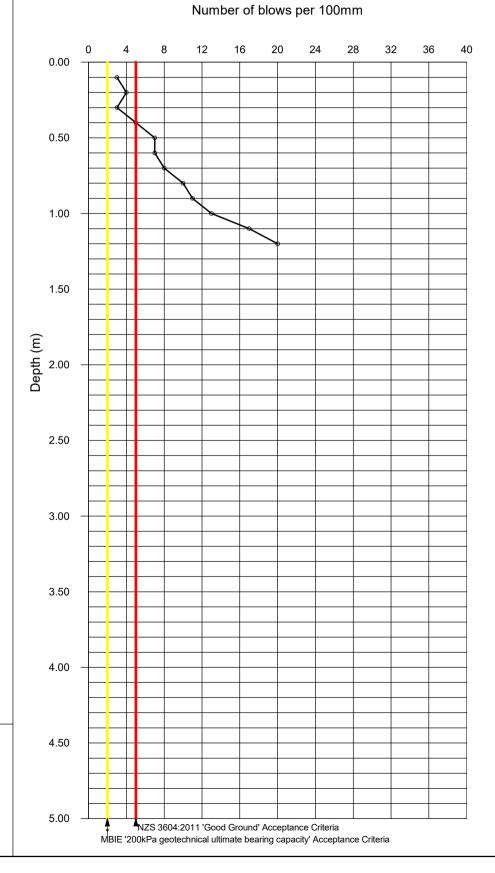



SCALA PENETROMETER NO.

Lot 4001 DCP2

www.aurecongroup.com PROJECT Prestons Park Subdivision Stage 2 PROJECT NO. 235361 TESTED / SUPERVISED BY C. WILSON CO-ORDINATES (NZTM) DATE 18/09/2018 E 1573362 N 5185737 CHECKED BY J. MARTIN GROUND LEVEL +13.26 m RL DATE 04/10/2018 Results Number of blows per 100mm Depth (m) Blows per 100 mm Blows per 100 mm 8 12 16 20 24 28 32 36 40 0.00 0.0 3.5 3 3 0.50 3 4 6 4.0_ 0.5 8 12 1.00 14 16 19 1.0 4.5_ 20 1.50 Depth (m) 2.00 5.0_ Report ID: AGS4 DCP (SCALA) RECORD (5M) || Project: LOT 422 EDITED.GPJ || Library: AGS 4 0. GLB || Date: 5 March 2021 2.0 2.50 3.00 2.5 3.50 4.00 Remarks: 4.50 20 blows for 100mm in the last increment. Co-ordinates and elevation data from site survey. Elevation based on Lyttelton Vertical Datum. Effective refusal, 20+ blows per 100mm penetration.

5.00

NZS 3604:2011 'Good Ground' Acceptance Criteria MBIE '200kPa geotechnical ultimate bearing capacity' Acceptance Criteria



SCALA PENETROMETER NO.

Lot 4001 DCP3

www.aurecongroup.com PROJECT Prestons Park Subdivision Stage 2 PROJECT NO. 235361 TESTED / SUPERVISED BY C. WILSON CO-ORDINATES (NZTM) DATE 18/09/2018 E 1573364 N 5185726 CHECKED BY J. MARTIN GROUND LEVEL +13.30 m RL DATE 04/10/2018 Results Number of blows per 100mm Depth (m) Blows per 100 mm Blows per 100 mm 8 12 16 20 24 28 32 36 40 0.00 0.0 3.5 3 3 0.50 3 6 7 4.0_ 0.5 8 10 1.00 13 13 15 1.0 4.5_ 17 1.50 20 Depth (m) 2.00 5.0_ Report ID: AGS4 DCP (SCALA) RECORD (5M) || Project: LOT 422 EDITED.GPJ || Library: AGS 4 0. GLB || Date: 5 March 2021 2.0 2.50 3.00 2.5 3.50 4.00 Remarks: 4.50 20 blows for 100mm in the last increment. Co-ordinates and elevation data from site survey. Elevation based on Lyttelton Vertical Datum. Effective refusal, 20+ blows per 100mm penetration. 5.00

NZS 3604:2011 'Good Ground' Acceptance Criteria MBIE '200kPa geotechnical ultimate bearing capacity' Acceptance Criteria



SCALA PENETROMETER NO.

Lot 4001 DCP4

www.aurecongroup.com PROJECT Prestons Park Subdivision Stage 2 PROJECT NO. 235361 TESTED / SUPERVISED BY C. WILSON CO-ORDINATES (NZTM) DATE 18/09/2018 E 1573375 N 5185738 CHECKED BY J. MARTIN GROUND LEVEL +13.19 m RL DATE 04/10/2018 Results Number of blows per 100mm Depth (m) Blows per 100 mm Blows per 100 mm 8 12 16 20 24 28 32 36 40 0.00 0.0 3.5 3 4 0.50 3 3 5 4.0_ 0.5 8 11 1.00 16 18 20 4.5 1.50 Depth (m) 5.0_ Report ID: AGS4 DCP (SCALA) RECORD (5M) || Project: LOT 422 EDITED.GPJ || Library: AGS 4 0. GLB || Date: 5 March 2021 2.0 2.50 3.00 2.5 3.50 4.00 Remarks: 4.50 20 blows for 100mm in the last increment. Co-ordinates and elevation data from site survey. Elevation based on Lyttelton Vertical Datum.

5.00

NZS 3604:2011 'Good Ground' Acceptance Criteria MBIE '200kPa geotechnical ultimate bearing capacity' Acceptance Criteria

Effective refusal, 20+ blows per 100mm penetration.





Aurecon New Zealand Limited

Level 2, Iwikau Building 93 Cambridge Terrace Christchurch 8013 New Zealand

T +64 3 366 0821

F +64 3 379 6955

E christchurch@aurecongroup.com

W aurecongroup.com

Aurecon offices are located in:

Angola, Australia, Botswana, China, Ghana, Hong Kong, Indonesia, Kenya, Lesotho, Macau, Mozambique, Namibia, New Zealand, Nigeria, Philippines, Qatar, Singapore, South Africa, Swaziland, Tanzania, Thailand, Uganda, United Arab Emirates, Vietnam.